AG4 096, 097, 098, 01M, 01N, 01P

PART NUMBER 119905-01K

COMPLAINT SECONDARY COMPLAINT

Delayed reverse, low line pressure in reverse

• Clutch failure • Shudder or slip on shift • Low clutch circuit pressure

CAUSE

Worn bushings and poor sealing ring performance associated with excessive clutch drum run-out and instability.


CORRECTION

The Sonnax precision bushings are designed to have tighter clearances for better drum stability and improved circuit integrity.

Bushing & Thrust Washer Kit

119905-01K

- 1 Forward Clutch Drum Bushing (K1)
- 1 Shaft Bushing (K1/096, 097, 098 only)
- 1 Reverse Clutch Drum Bushing (K2)
- 1 Pump Gear Bushing
- 1 Pump Housing Bushing
- 1 Thrust Washer, OE thickness
- 1 Thrust Washer, .015" thicker

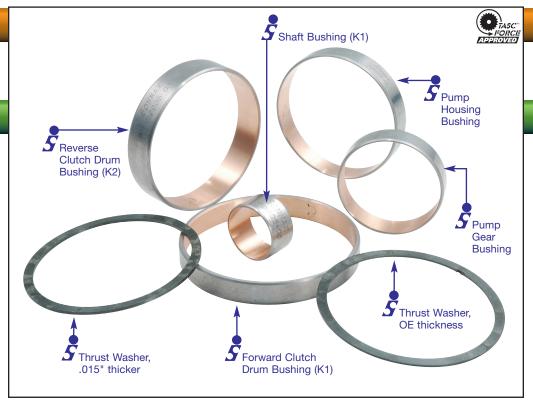

Sonnax Part Summary

Worn bushings and poor sealing ring performance caused by excessive clutch drum run-out and instability can cause a variety of complaints in VW units. These include delayed reverse, low line pressure in reverse, clutch failure, shudder or slip on shift, and low clutch circuit pressure. The Sonnax bushing & thrust washer kit 119905-01K contains five precision bushings and two thrust washers with tighter tolerances for improved sealing characteristics.

Features & Benefits

- Bushings are steel-backed and bronze-lined for better wear resistance.
- Tighter clearances provide better drum stability and improved circuit integrity.
- No machining required for bushing installation.

\$ave

Hundreds in pump and drum replacement costs

