

COMPLAINT

SECONDARY COMPLAINT

Vehicle exhibits trouble code P0741 TCC stuck "off"

- High TCC slip rate (TCCMACT) increases with operating temperature due to apply oil loss

CAUSE

Worn stator bushings allow TCC apply pressure to exhaust through the already exhausting TCC release passages.


CORRECTION

The tightly toleranced Sonnax bushings restore proper clearances.

Turbine Shaft Stator Bushings

46000-01K

2 Turbine Shaft Stator Bushings

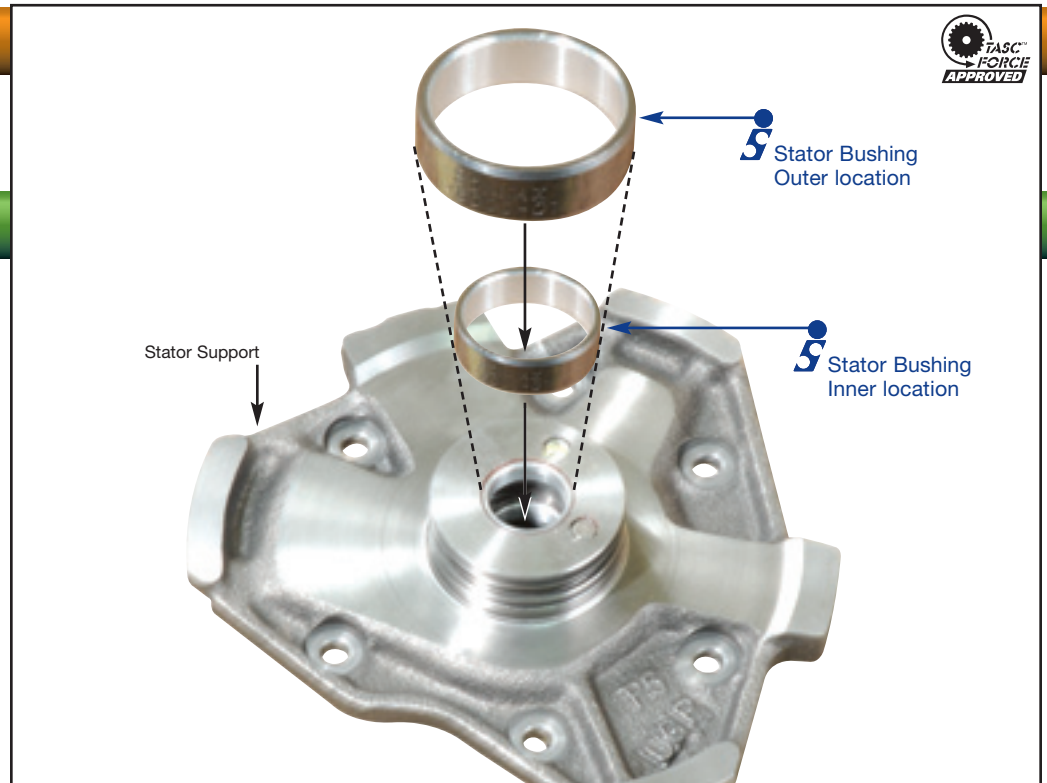

Sonnax Part Summary

Sonnax offers a new bushing kit, **46000-01K**, to replace OEM bushings that are known for wearing prematurely. The worn bushing can result in Code P0741 TCC stuck off and high TCC slip rates.

Features & Benefits

- Direct OEM replacement.
- Corrects TCC codes caused by loss of TCC apply pressure.
- Tightly toleranced to prevent TCC apply pressure from exhausting.