

COMPLAINT

SECONDARY COMPLAINTS

Premature clutch/band failure, poor reverse boost

- Soft shifts • Insufficient line rise • Erratic buzz or uncontrollable pressure in reverse

CAUSE

An out-of-position accumulator shift valve creates soft or flared upshifts.

CORRECTION


This updated design eliminates the OEM split valves and seals all circuits.

Accumulator Shift Valve

63940-03K

- 1 Shift Valve
- 1 O-Ring
- 1 Spring

Note: Replaces early or late OEM line-ups in most valve bodies. Some late valve bodies do not have an accumulator shift valve.

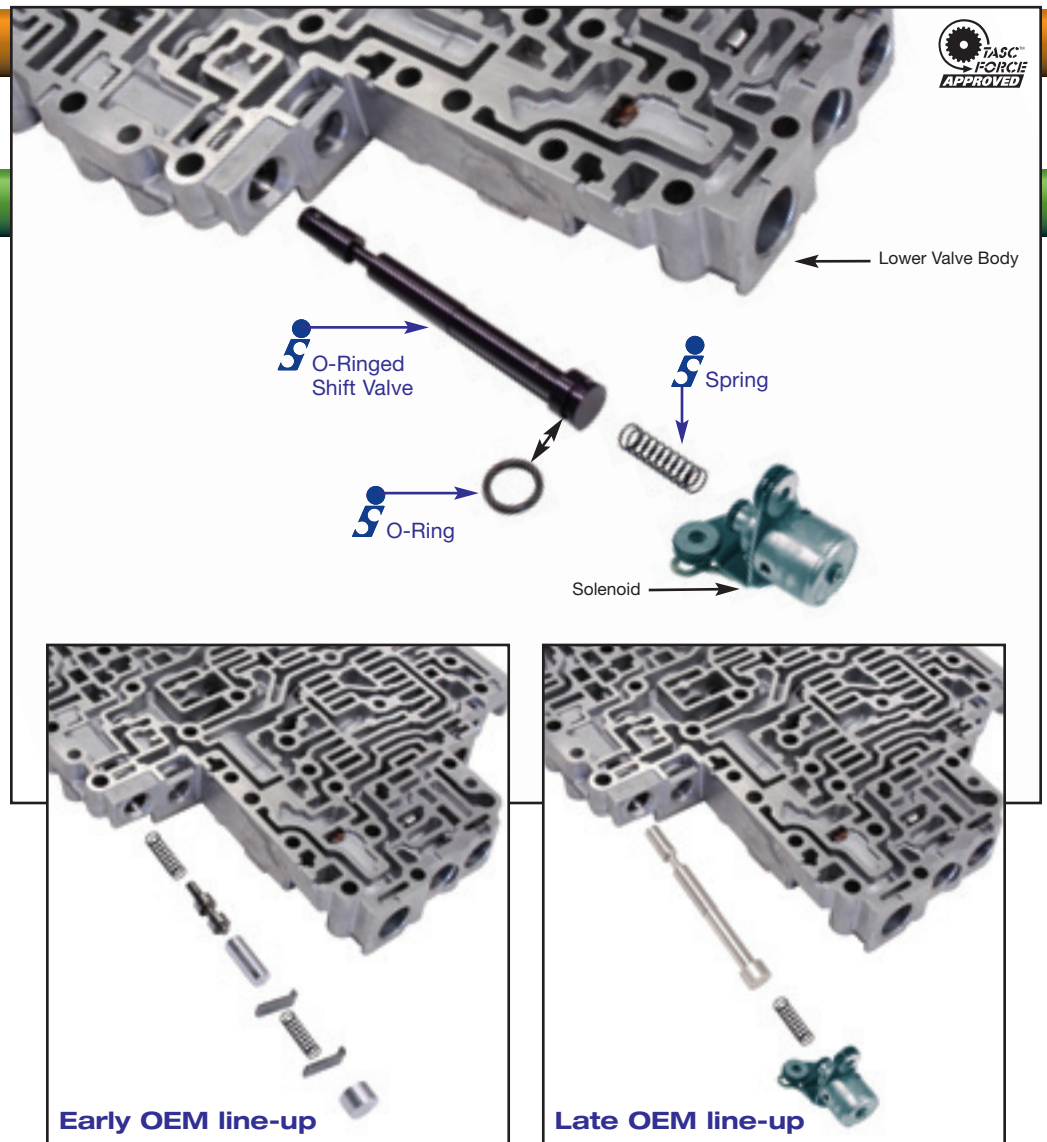

Sonnax Part Summary

The accumulator shift valve line-up has been changed numerous times by OEM, and incorrect reassembly can result in soft or flared upshifts. This kit includes an accumulator shift valve that will be correctly positioned to prevent soft or flared upshifts.

Features & Benefits

- Shift valve provides proper circuit flow to prevent soft or flared upshifts.
- Sonnax design replaces all OEM line-ups that use an accumulator shift valve.