

COMPLAINT

2nd & 4th clutch failure

CAUSE

Wear of the accumulator pin and piston creates cross leakage of D-4 oil.

CORRECTION

This oversized accumulator pin and reamer obtain a good hydraulic seal and improve 2nd and 4th clutch apply by reaming and reusing the worn, original piston with the oversized pin.

Oversized Accumulator Pin & Reamer


84573-01K

4 Accumulator Pins

84573-02K

10 Accumulator Pins

1 Reamer

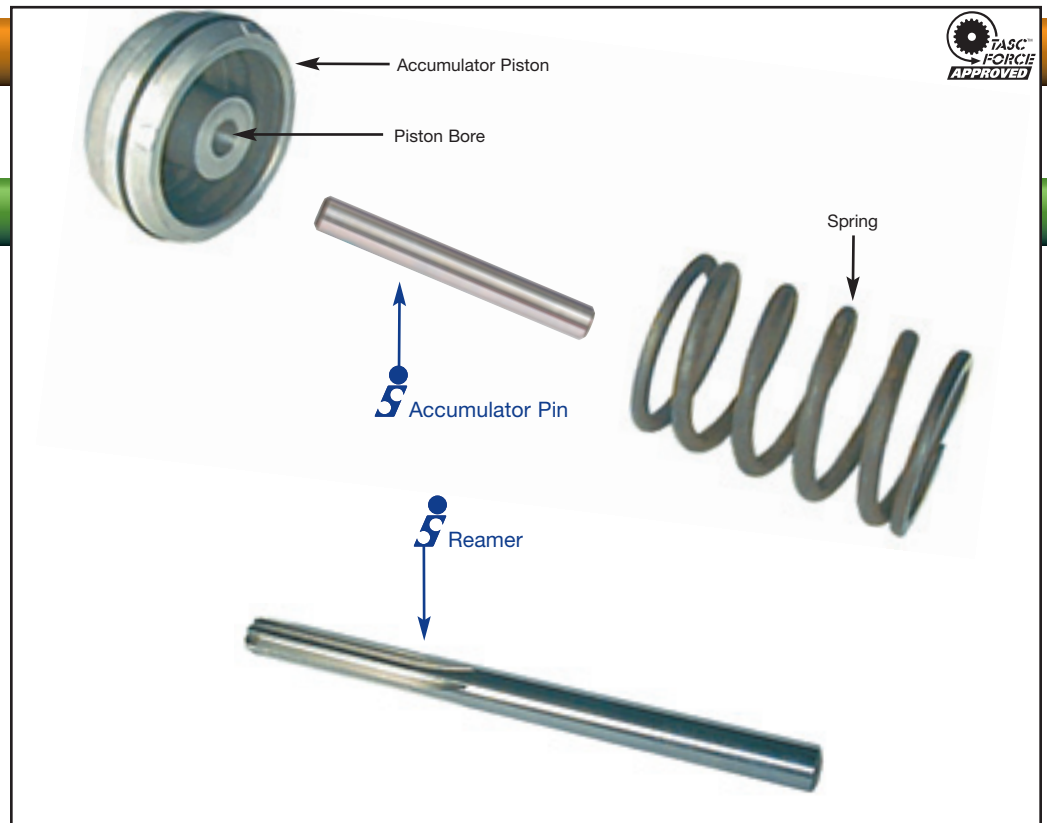

Sonnax Part Summary

Accumulator pin and piston wear in 4T60 & E and 440-T4 units creates cross leakage of D-4 oil, causing 2nd and 4th clutch failure. Sonnax has designed an oversized pin **84573-01K** to overcome cross leakage.

Features & Benefits

- Oversized pin creates a good hydraulic seal with the original piston.
- A starter kit **84573-02K** includes a reamer for boring out the original piston pin bore.
- Improves 2nd and 4th clutch apply.
- Salvages accumulator pistons.