

COMPLAINT

No upshift, 3-2 coastdown neutral

CAUSE

The valve constantly bangs the clip, resulting in broken clips that get lodged and sometimes damage the end of the valve.

CORRECTION

This valve saver cap and retainer clip allows reuse of the 3-2 shift timing valve, and prevents future damage.

Valve Saver Cap

96201-15K

5 Valve Saver Caps
5 Retainer Clips


US Patent No. 6,722,385

Also Available

96201-10

Retainer Clip

Note: These retainers are applicable to numerous Ford valve body locations.

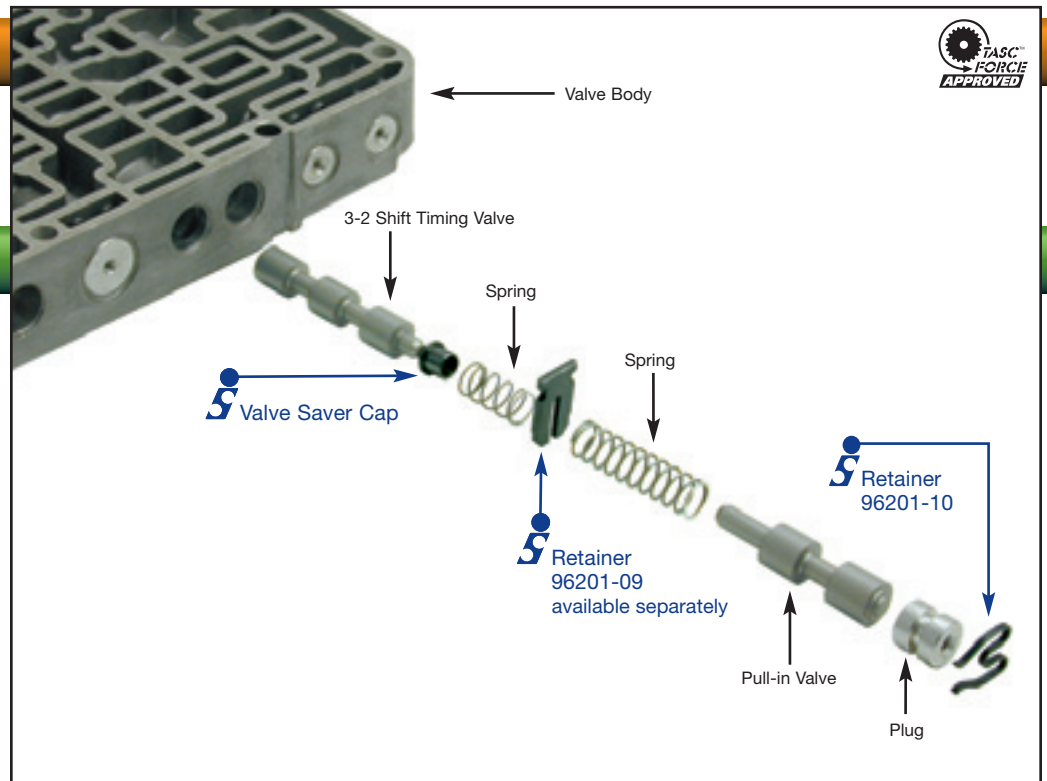

Sonnax Part Summary

Continuous banging of the 3-2 shift timing valve spring stem against the steel retainer results in damaged valves and/or broken retainers. Sonnax has designed a valve saver cap and retainer kit, 96201-15K, to salvage a damaged 3-2 shift timing valve.

Features & Benefits

- Steel end cap allows valve salvage and prevents future damage.
- Replacement retainer also included.