

COMPLAINT

No forward or no 3rd gear

CAUSE

Insufficient factory press fit between the tubes and case results in tube blow-off.


CORRECTION

This bolt-on bracket positively retains the servo tubes, eliminating the chance of blow-off.

**Servo Tube
Bracket**

96806

1 Servo Tube Bracket

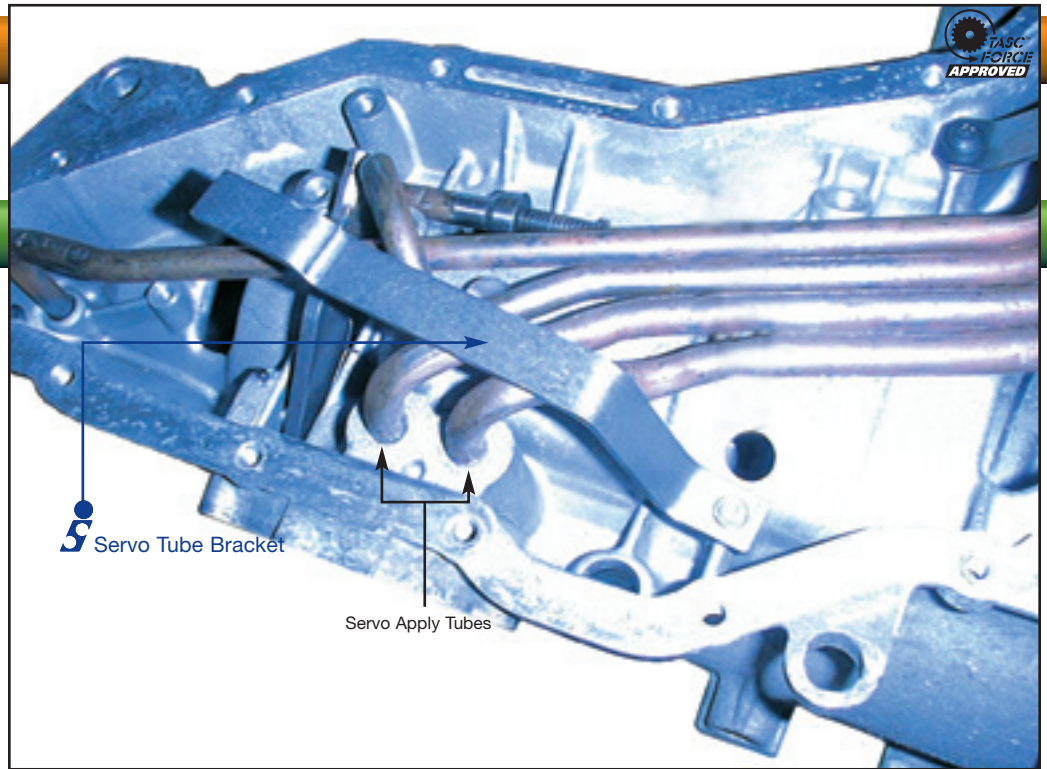

Sonnax Part Summary

The servo tubes on AXOD & E units may walk off from the transmission case. This causes the servo piston to release and create a no forward condition. There may be insufficient press fit between the tubes and case to withstand the servo apply pressure. If the tubes have been removed for cleaning, the possibility of walk-off increases. Install the Sonnax AXOD & E servo tube bracket **96806**. It is an easy-to-install bolt-on bracket that positively retains the servo tubes.