

COMPLAINT

SECONDARY COMPLAINTS

Clutch failure

- Burned clutches
- Shift complaints

CAUSE

Continuous oscillation of the steel clutch apply control plunger valve wears the cast-aluminum sleeve bore, allowing clutch apply pressure to exhaust and preventing proper control of the clutch apply control valve.


CORRECTION

The tightly tolerated, drop-in replacement Sonnax valve and sleeve assembly restores proper hydraulic clearances and uses upgraded materials to prevent wear.

Clutch Apply Control Plunger Valve & Sleeve Kit

57917E-05K

- 1 Clutch Apply Control Plunger Valve
- 1 Clutch Apply Control Sleeve

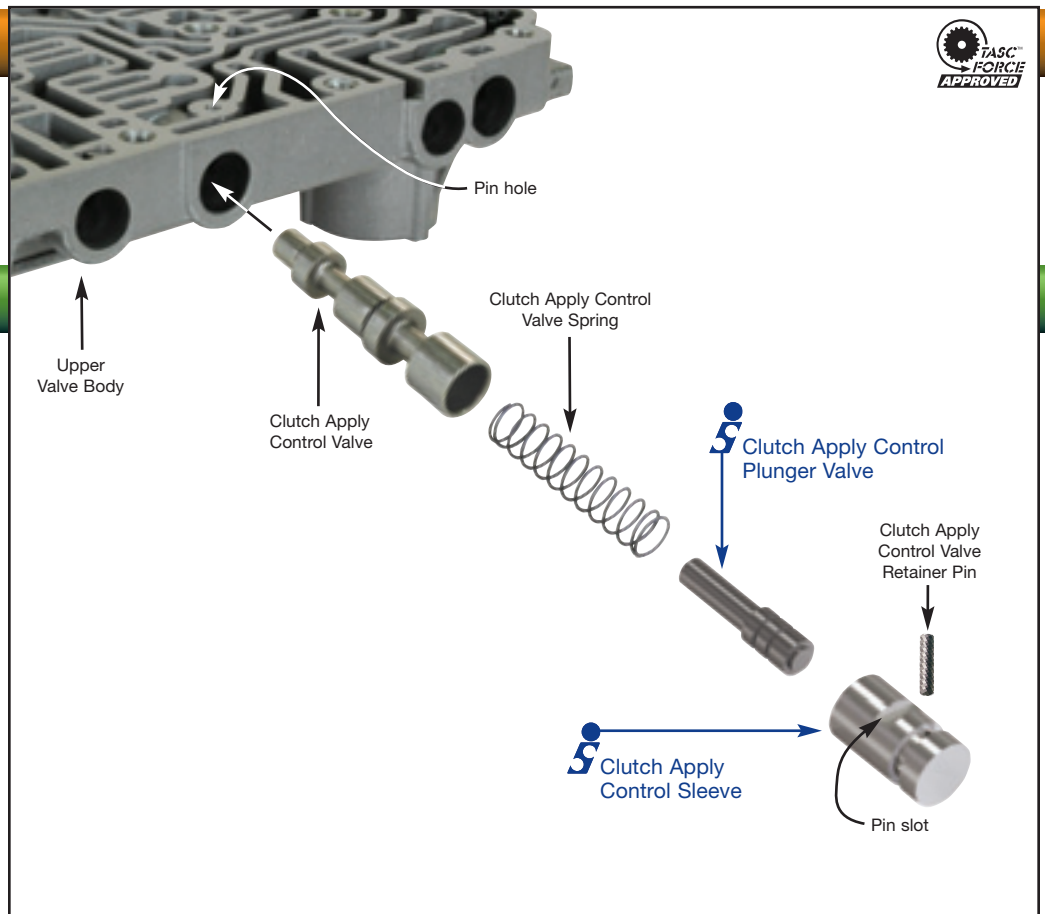

Features & Benefits

- The Sonnax sleeve is manufactured from highly wear-resistant billet aluminum.
- The Sonnax valve has been manufactured from hard-coat anodized aluminum to prevent wear.
- Annular grooves have been added to the valve to prevent sidelading related wear.

You need this if...

Visual inspection indicates wear to the original assembly.