CD4E, LA4AE

PART NUMBER 73300-

Reverse Clutch Drum Sleeve

Complaint

ONDARY COMPLAINT • Costly drum replacement

CAHE

A soft reverse clutch drum journal.

Correction


Salvage damaged reverse clutch drums by machining and installing the Sonnax pre-hardened steel sleeve.

Reverse Clutch Drum Sleeve

73300-01

1 Reverse Clutch Drum Sleeve



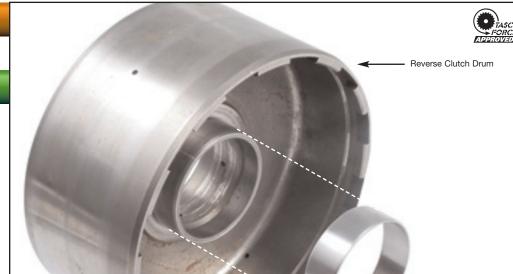

Bushing failure and/or reverse clutch drum journal damage

Sonnax Part Summary

A soft reverse clutch drum journal can cause bushing failure and/or reverse clutch drum journal damage in CD4E, LA4AEL units. Sonnax now offers a reverse clutch drum sleeve, **73300-01**, that extends the life of the reverse clutch drum bushing journal and allows salvage of drums with worse or damaged bushing journals.

Features & Benefits

- Pre-hardened steel sleeve is precision machined.
- More durable, wear-resistant bushing journal.
- Allows salvage of worn reverse clutch drums.

